



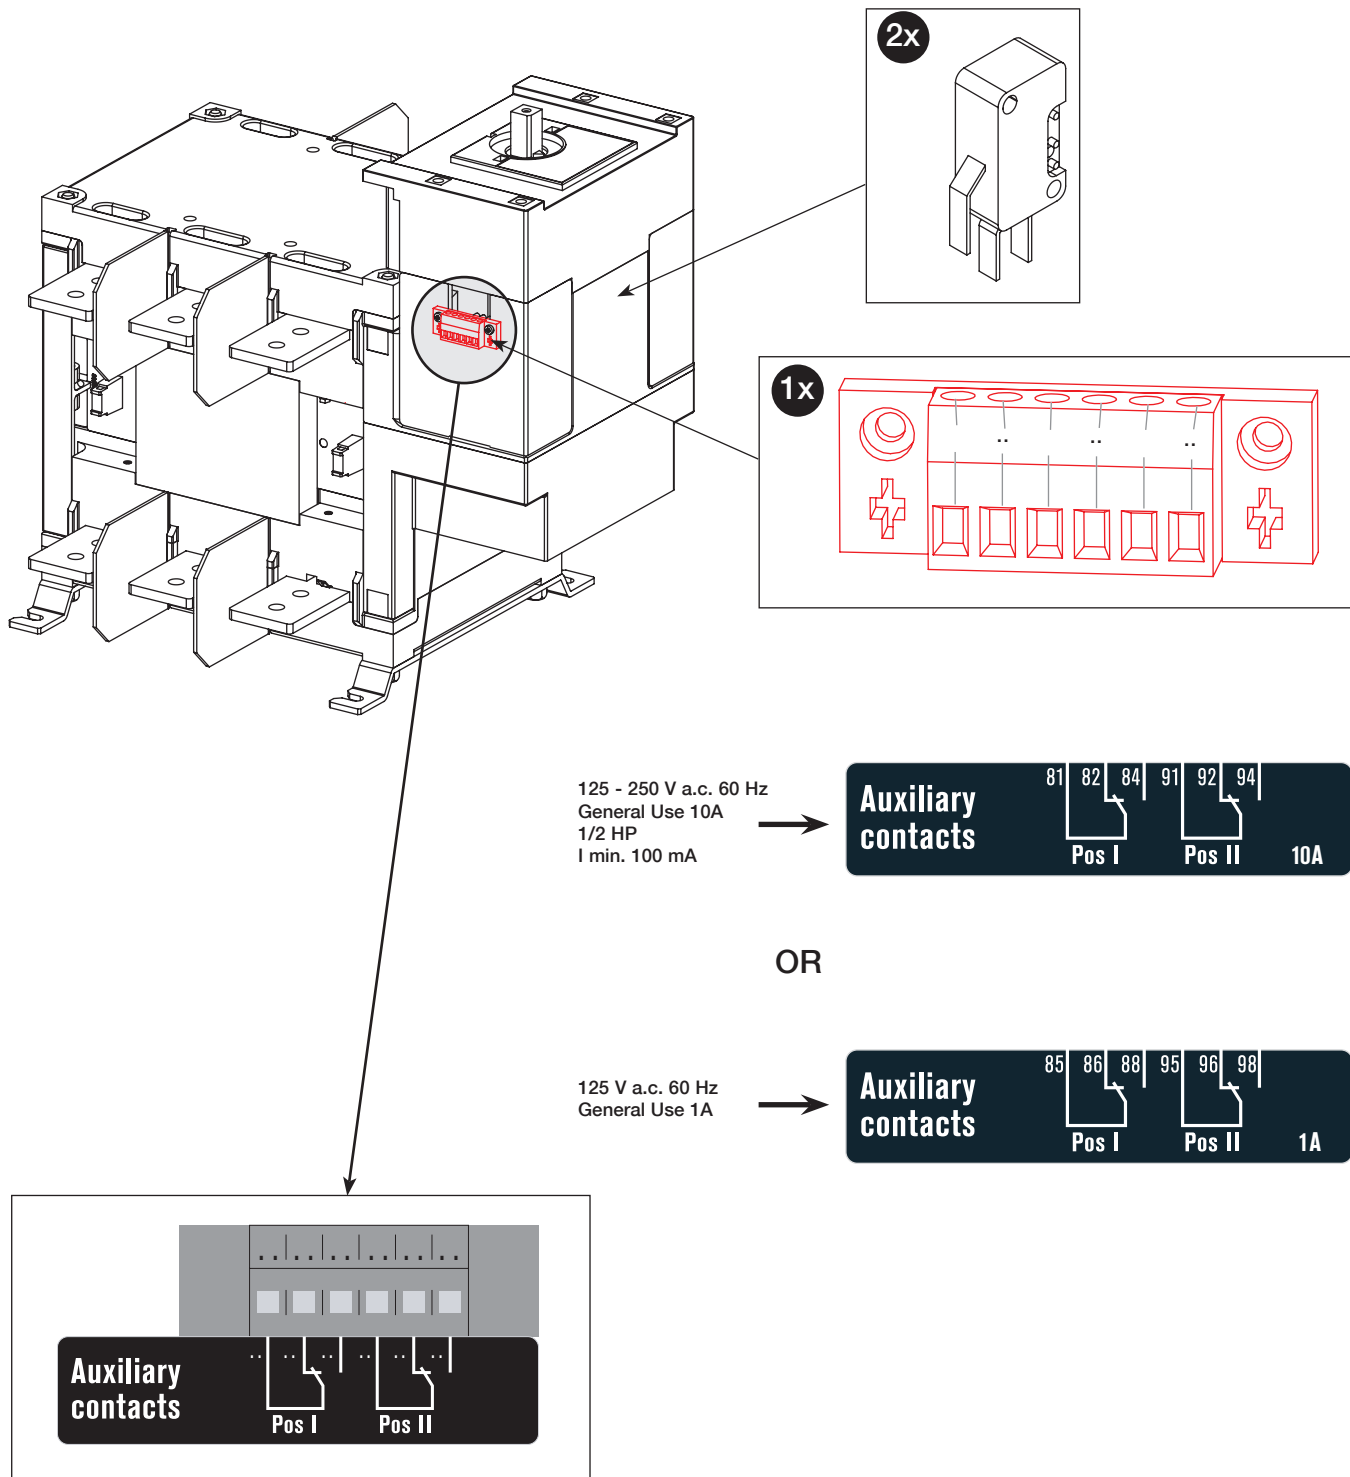


s. El incumplimiento de estas precauciones podrá causar la muerte o lesiones serias.

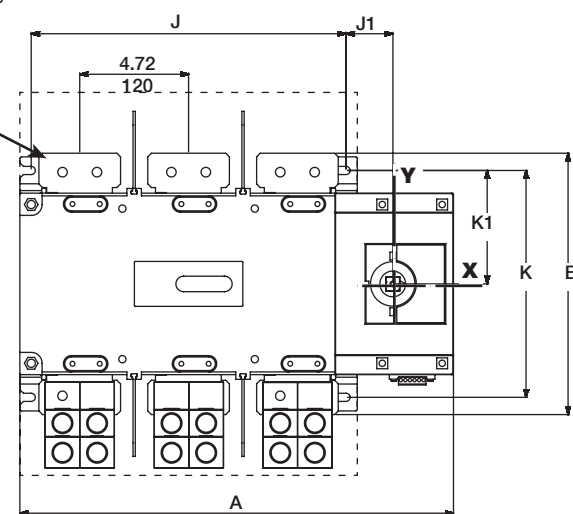

		A		B		C		H		H1		H2		J		J1		K		K1		Y		Y1	
		in	mm	in	mm	in	mm	in	mm	in	mm	in	mm	in	mm	in	mm	in	mm	in	mm	in	mm	in	mm
①	3 P	15.19	386	13.38	340	14.56	370	9.09	231	13.66	347	9.05	230	10.04	255	2.02	51,5	9.84	250	4.92	125	2.61	66,5	9.98	253,5
②	4 P	18.34	466											13.18	335										
③	3 P	18.81	478	11.34	288	14.56	370	8.30	211	13.66	347	8.03	204	13.66	347	2.02	51,5	9.84	250	4.92	125	2.65	67.3	9.98	253,5
④	4 P	23.54	598											18.38	467										
⑤	3 P	18.81	478	11.34	288	14.56	370	8.30	211	13.66	347	8.03	204	13.66	347	2.02	51,5	9.84	250	4.92	125	2.66	67,5	9.98	253,5
⑥	4 P	23.54	598											18.38	467										


- 1 41503060
- 2 41504060
- 3 41503080
- 4 41504080
- 5 41503120
- 6 41504120

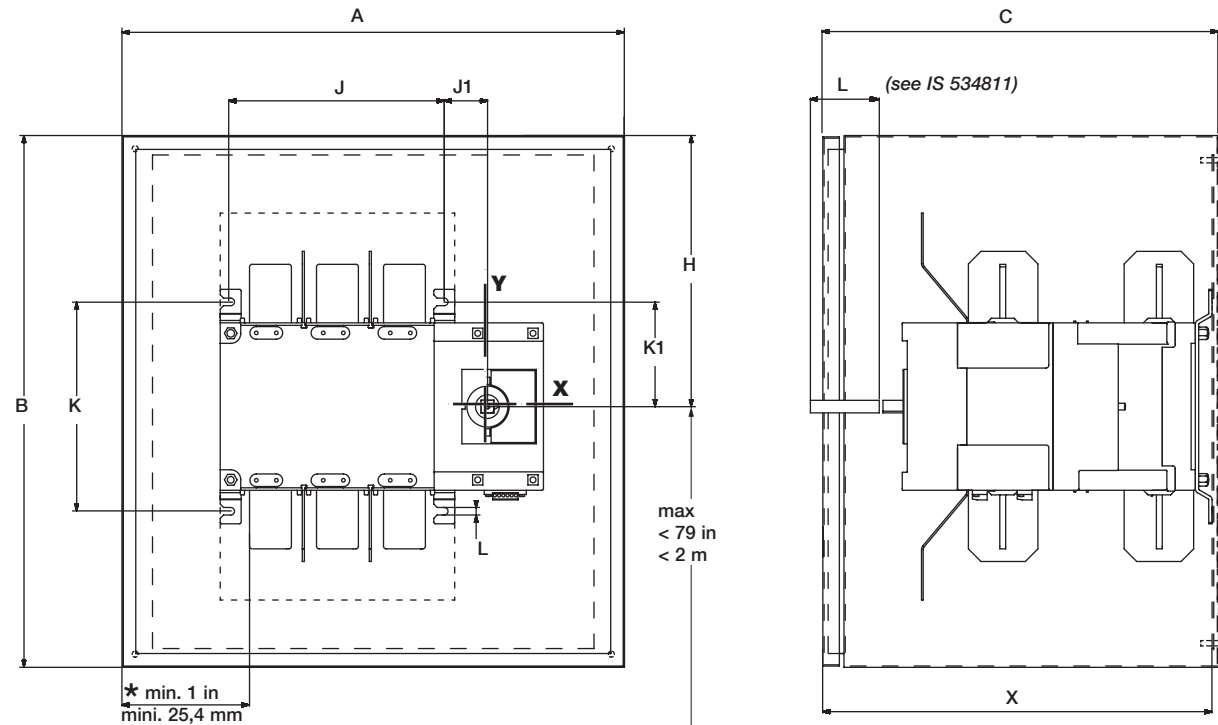

* Minimum required spacings
Minimum enclosure dimensions
Dimensions minimum des coffrets
Dimensiones minimas de las cajas

		A		B		C		H		J		J1		K		K1		L	
		in	mm	in	mm	in	mm	in	mm	in	mm	in	mm	in	mm	in	mm	in	mm
1	3 P	36	915	48	1220	20	508	24	610	10.04	255	2.02	51,5	9.84	250	4.92	125	0.35	9
2	4 P	36	915	60	1524	20	508	30	762	13.66	347	2.02	51,5	9.84	250	4.92	125	0.35	9
3	3 P	36	915	60	1524	20	508	30	762	18.38	467	2.02	51,5	9.84	250	4.92	125	0.35	9
4	4 P	36	915	60	1524	20	508	30	762	18.38	467	2.02	51,5	9.84	250	4.92	125	0.35	9
5	3 P	36	915	60	1524	20	508	30	762	13.66	347	2.02	51,5	9.84	250	4.92	125	0.35	9
6	4 P	36	915	60	1524	20	508	30	762	18.38	467	2.02	51,5	9.84	250	4.92	125	0.35	9

- USED FOR
- 16093063 3P → 1 41503060
 - 16094063 4P → 2 41504060
 - 16093080 3P → 3 41503080 5 41503120
 - 16094080 4P → 4 41504080 6 41504120

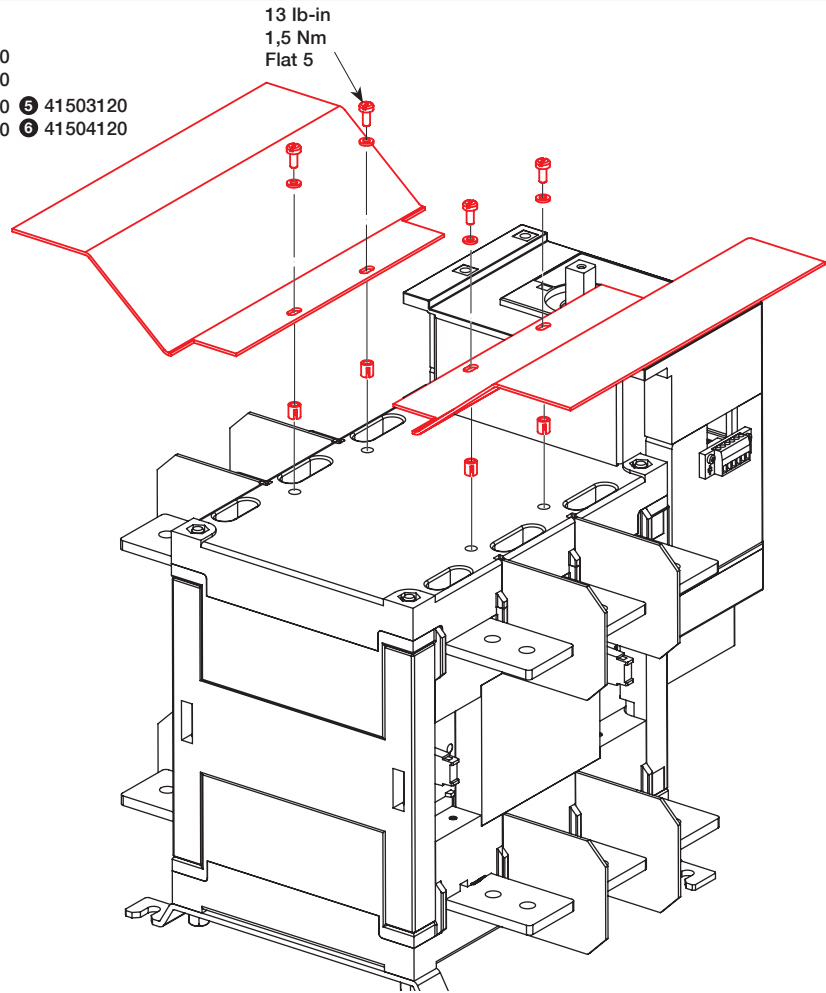


Cable size Section de câble Sección de cables


Use CMC, PV2 600 lugs.
Utiliser les bornes à cage CMC, PV2 600.
Utilizar los bornes CMC, PV2 600.

Quantity per terminal Quantité par pôle Cantidad por pala		Size / Section Sección (AWG)		Openings per lug. Nombre de points de connexion. Numero de puntos de conexión.
		min.	max.	
1x	1	3 P	# 2	2
1x	2	4 P	# 2	2
1x	3	3 P	# 2	2
1x	4	4 P	# 2	2
2x	5	3 P	# 2	2 x 2
2x	6	4 P	# 2	2 x 2


- Bridging bars
Barres de pontage
Pletina de puenteado
- USED FOR
UTILISE POUR
Utilizado para
- 41593063 3P → 1 41503060
 - 41594063 4P → 2 41504060

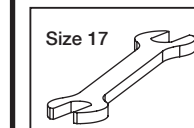


* not provided
non fourni
No entregado

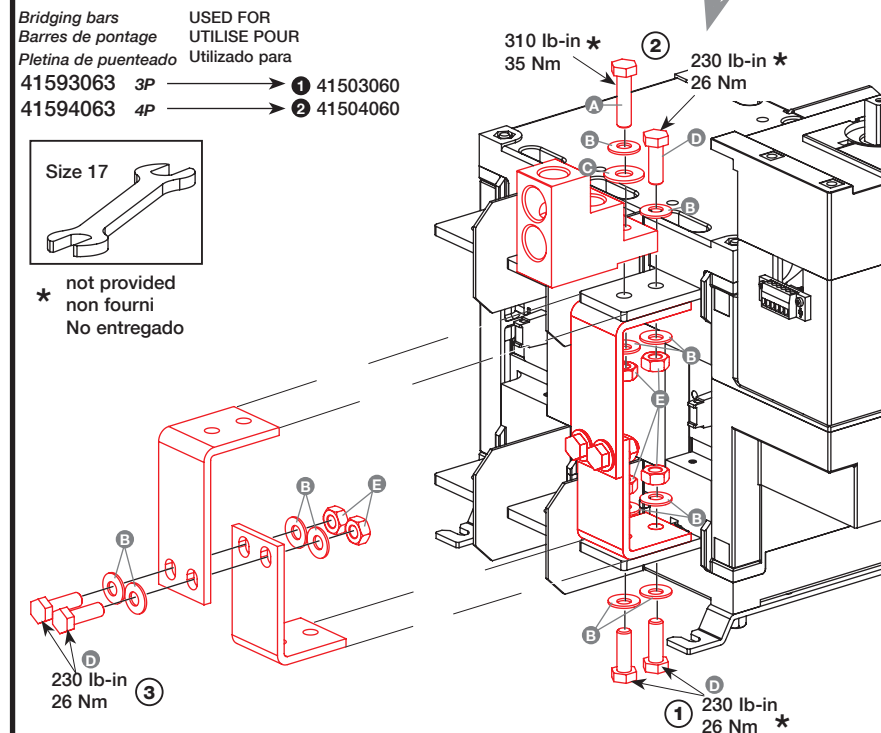

- Bridging bars
Barres de pontage
Pletina de puenteado
- USED FOR
UTILISE POUR
Utilizado para
- 41593080 3P → 3 41503080 5 41503120
 - 41594080 4P → 4 41504080 6 41504120

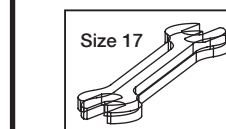

* not provided
non fourni
No entregado

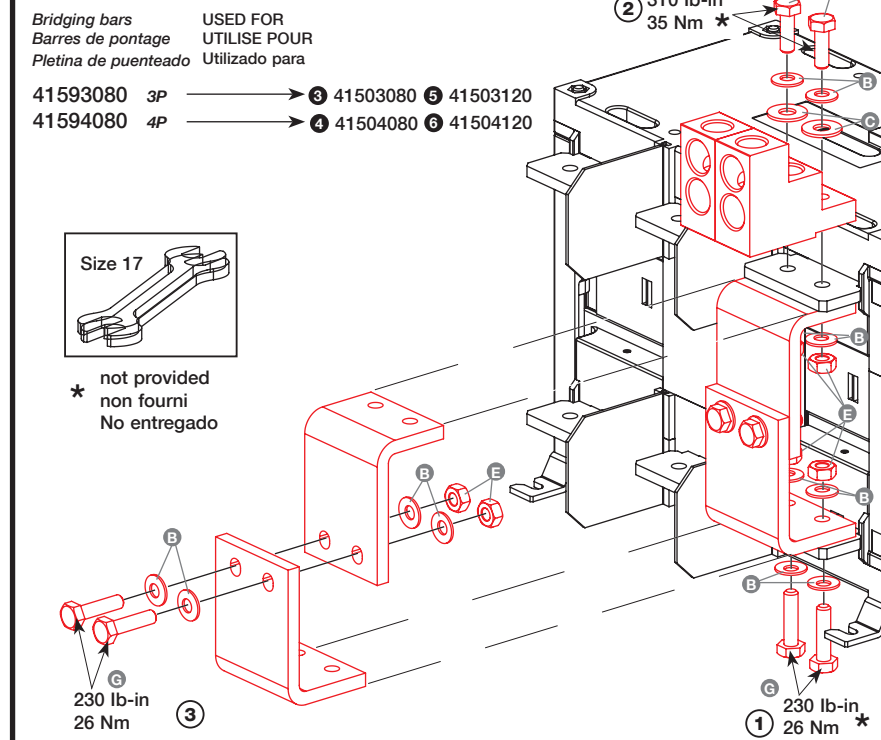

Screw description Description visserie Descripción tornillería	
A Screw Vis Tornillo	H M10 x 50 - 6.8
B Contact washer Rondelle contact Arandela	M10 NFE 25 511
C Flat washer Rondelle plate Arandela plana	M10 NFE 25 513
D Screw Vis Tornillo	H M10 x 30 - 6.8
E Screw nut Ecrou Tuerca	M10 x 10 - 6.8
F Screw Vis Tornillo	H M10 x 45 - 6.8
G Screw Vis Tornillo	H M10 x 40 - 6.8

